

Service Bulletin No. 1051

For ABC/ICP staff only

MODEL : All

TYPE: Service information

MANUAL &

SECTION: Maintenance Manual: Chapter 5 - Brakes

DATE: September 30th, 2000

SUBJECT: Webb brake drums fitted to DANA drive axles with

drum brakes

CONDITIONS: Service information only. Note that no claims will be accepted

with reference to this Bulletin.

DESCRIPTION:

1. Properly balanced brake drums can be identified as follows:


- They are either originally fitted to axles, bearing # 45 03/99 or higher on the axle housing identification plate or,
- They are marked with the suffix "V" after "REV A", "REV B" or "REV C".
- 2. From delivery week 51/99 on (December 20th, 1999) all units shipped should be equipped with properly balanced brake drums.
- 3. From then on it is no longer necessary to swap brake drums.

NOTE

In order to balance brake drums properly, it is necessary to center them to the bore, and not to the stud holes (refer to Service Bulletin No. 1053).

This Bulletin is one of a special series, custom made for ABC/ICP and intended for internal use by these companies and their branches. Under no circumstances should information contained herein be made public or used to replace or supplement customer oriented information without prior consent by Van Hool.

K:\SERVICEB\USA\PMSB#\SB1051LDW

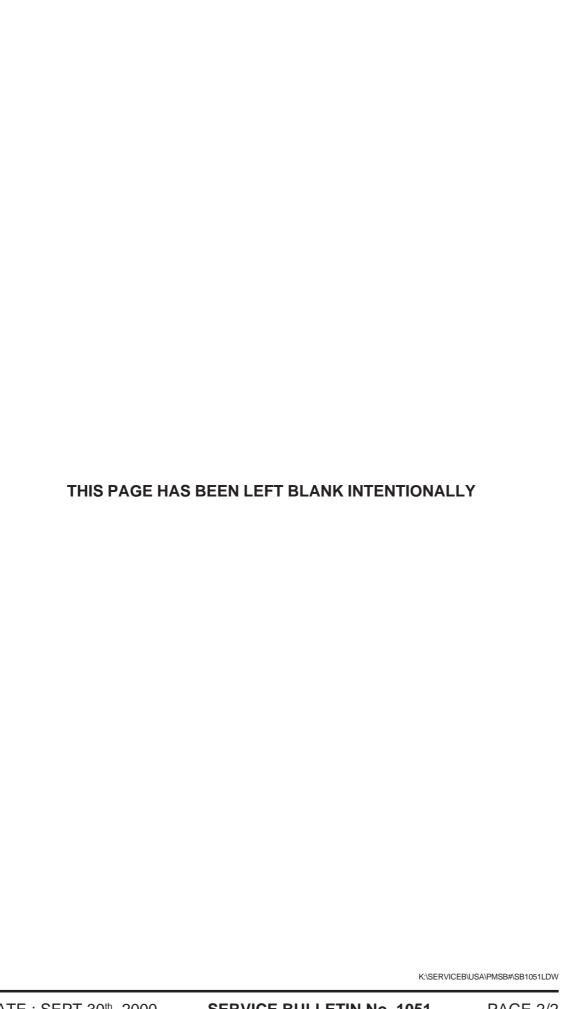

DATE : SEPT 30th, 2000 SERVICE BULLETIN No. 1051 PAGE 2/2