

SERVICE BULLETIN

SB1616

ADDRESSEES: ABC Customer Care and Parts Source

Owners and operators of coaches listed under "Application"

VEHICLE MODEL : CX35

MANUAL CHAPTER : 10.62 Body and accessories - Service door

BULLETIN TYPE : Field change program

DATE : May 8th, 2019

SUBJECT : To improve wheelchair lift door sealing

TERMS & CONDITIONS: Refer to the warranty section further in this Bulletin

APPLICATION

The field change program, subject of this Bulletin, is applicable to CX35 vehicles equipped with a wheelchair lift.

INTRODUCTION

In order to prevent water infiltration via the wheelchair lift door, the sealing of this door has to be improved. Extra treatment of the door sealing with silicone paste in combination with a larger receptacle and another striker has to guarantee better tightness.

Owners and operators of the affected units should follow the procedure below.



COMPONENTS AND PRODUCTS

Continued on next page

SPECIAL TOOLS, EQUIPMENT OR SERVICES:

VH reference	Description
11569964	Sikaflex 268 silicone paste
660193035	Sika activator 205 degreaser

PREPARATIONS:

- Park the vehicle over a flat inspection pit, with the front wheels in the straight-ahead position.
- Apply the parking brake. Stop the engine.
- Switch off all systems and turn off the battery isolation switch on the dashboard.
- Open the mechanical battery isolation switch.
- Put a "DO NOT START" warning on the instrument panel before starting the works.
- Put chocks in front of and behind the drive axle wheels.
- · Read the entire procedure before starting to work.



WARNING!

Observe safe shop practices at all times.

PROCEDURE

Step	Action	
1	Change the striker and improve sealing on door leaf as described further on under	
	"STEP 1 IN DETAIL".	
2	Change the receptacle as described further on under "STEP 2 IN DETAIL".	
3	Add additional silicone paste as described further on under "STEP 3 IN DETAIL".	
4	Notify ABC Companies by mail. Write the text "SB1616 completed for VIN" in the	
	mail and send the mail to warranty@abc-companies.com.	
5	For ABC Companies only: register through the registration button located behind the	
	Service Bulletin on the Van Hool customer portal. Write the text "SB1616 completed" in	
	the field "Remark". Labor allowance will only be awarded after Van Hool has received	
	the registration.	

End of procedure

STEP 1 IN DETAIL: To change striker and improve sealing on door leaf

Step	Action	
1.1	Action At the rear side of the door leaf: remove the rubbers indicated in figures 3 and 4. Figure 3 O15502	

Continued on next page.

1.2 At the rear side of the door leaf: remove the striker. Keep the screws and spring washers at hand for re-use later.



015479A Figure 5

- 1.3 At the rear side of the door leaf: install striker 91203806 from the kit with the screws and spring washers removed in previous step. Tighten the screws to a torque of 8.5 ± 1 Nm $(6.3 \pm 0.7$ ft.lbf).
- 1.4 At the rear side of the door leaf: re-install the door rubbers as follows:
 - a. Thoroughly clean the part of the door leaf that will receive the door rubber with Sika activator 205 degreaser or similar.
 - b. Apply an uninterrupted bead of Sikaflex 268 silicone or equivalent to the part of the door leaf that will receive the door rubbers.
 - c. Re-install the door rubbers.

STEP 2 IN DETAIL: To change receptacle at rear door post

2.1 Remove the receptacle. Keep the screws at hand for re-use later.


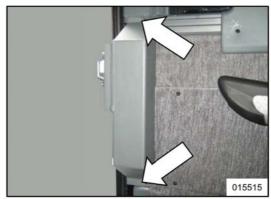


Figure 6

Apply Sikaflex 268 silicone paste or equivalent to receptacle 11667447 from the kit as indicated in the figure. Install the new receptacle using the screws removed in previous step.

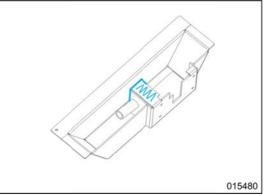

015480 Figure 7

STEP 3 IN DETAIL: To add additional silicone paste

Step	Action		
3.1	Apply Sikaflex 268 silicone paste or equiv	alent:	
		ne thread hole for the end stop (1, figure 8); ng the lip of the outside rubber (figure 9), al nd the body (2, figure 8).	
	015504 Figure 8	Figure 9: Lift the lip of the outside rubber to apply paste	

3.2 At the door opening frame:

- a. Remove the rubber at the inside of the door frame opening.
- b. Thoroughly clean the part of the door frame that will receive the door rubber with Sika activator 205 degreaser or similar.
- c. Apply an uninterrupted bead of Sikaflex 268 silicone paste or equivalent into the groove of the rubber.
- d. Re-install the door rubber.



Figure 10

On the front door post: apply an uninterrupted bead of Sikaflex 268 silicone or equivalent around both door lock cylinder apertures.

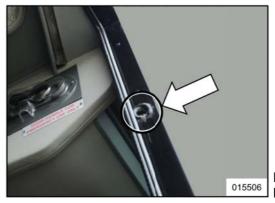



Figure 11: Upper door lock cylinder aperture

On the rear door post: apply an uninterrupted bead of Sikaflex 268 silicone or equivalent to the top of the profile as indicated in the figure.



Figure 12

On the rear door post: apply an uninterrupted bead of Sikaflex 268 silicone or equivalent to the places indicated in figures 12 and 13.

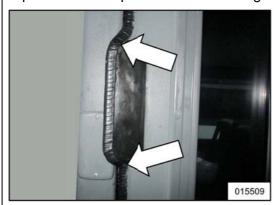

015510

Figure 13: At the top

Figure 14: At the bottom

3.6 At the rear door post: apply an uninterrupted bead of Sikaflex 268 silicone or equivalent around both door pins.



Figure 15: Upper door pin

3.7 At the rear side of the door leaf: apply an uninterrupted bead of Sikaflex 268 silicone paste or equivalent around both door locks as indicated in the figure below.

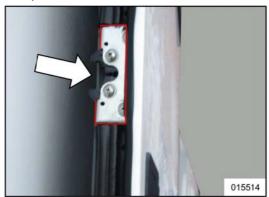


Figure 16: Silicone paste around lower door lock

WARRANTY:

1. Terms and conditions:

Van Hool will accept warranty claims for this repair as follows:

Parts: parts will be supplied through regular channels, free of charge

Labor allowance: 4 hours of labor will be awarded per vehicle **Campaign/expiration date:** Service Bulletin issue date + 1 year

2. Claim references:

Job code: O61616N

Claim submission: Contact ABC Customer Care Warranty Department for guidance.

Monitoring and performance: The claim records pertaining to this Bulletin will be used to determine that the remedy has been executed in accordance with the manufacturer's instructions and to evaluate the status of this Field Change Program.

HELP DESK:

If there are any questions, please call ABC Customer Care & Parts Source toll-free for guidance on 1-877-427-7278. Listen for the prompts for warranty and select that option.

DISCLAIMER:

The procedures contained herein are not exclusive. Van Hool cannot possibly know, evaluate, or advise the transportation industry of all conceivable ways in which a procedure may be undertaken or of the possible consequences of each such procedure. Other procedures may be as good, or better, depending upon the particular circumstances involved. Each carrier who uses the procedures herein must first satisfy itself thoroughly that neither the safety of its employees or agents, nor the safety or usefulness of any products, will be jeopardized by any procedure selected.

VAN HOOL CUSTOMER PORTAL:

Consult the customer portal regularly for the latest service documentation. Beside the maintenance manual, you will also find the operating manual and the spare parts catalogue of your vehicle on the customer portal. The customer portal is accessible through www.vanhool.be, and only with a code (password) from Van Hool. If you do not have a password yet, request it by using the link on the Van Hool website.

INFORMATION HANDLING:

Important additions and modifications regarding technical information not yet included in the manual will be communicated through Service Bulletins.