

COACH MODEL : T2140, T2145 and C2045 with DD13 Engines
DATE : 11/09/2012
SUBJECT : Auxiliary Air Leak With Detroit Diesel Engine Code 4335/1


Detroit Diesel has identified a potential air leak at the turbo waste gate air fitting and have updated it with a new part and part number.

If the fitting is leaking, some or all of the following symptoms might be present.

- Engine warning light
- Low auxiliary air pressure
- Code 4335/1 (SPN/FMI) Diesel Exhaust Fluid (DEF) air pressure not detected
- Audible air leak



The new part number that is supplied by Detroit Diesel is: A0019977570

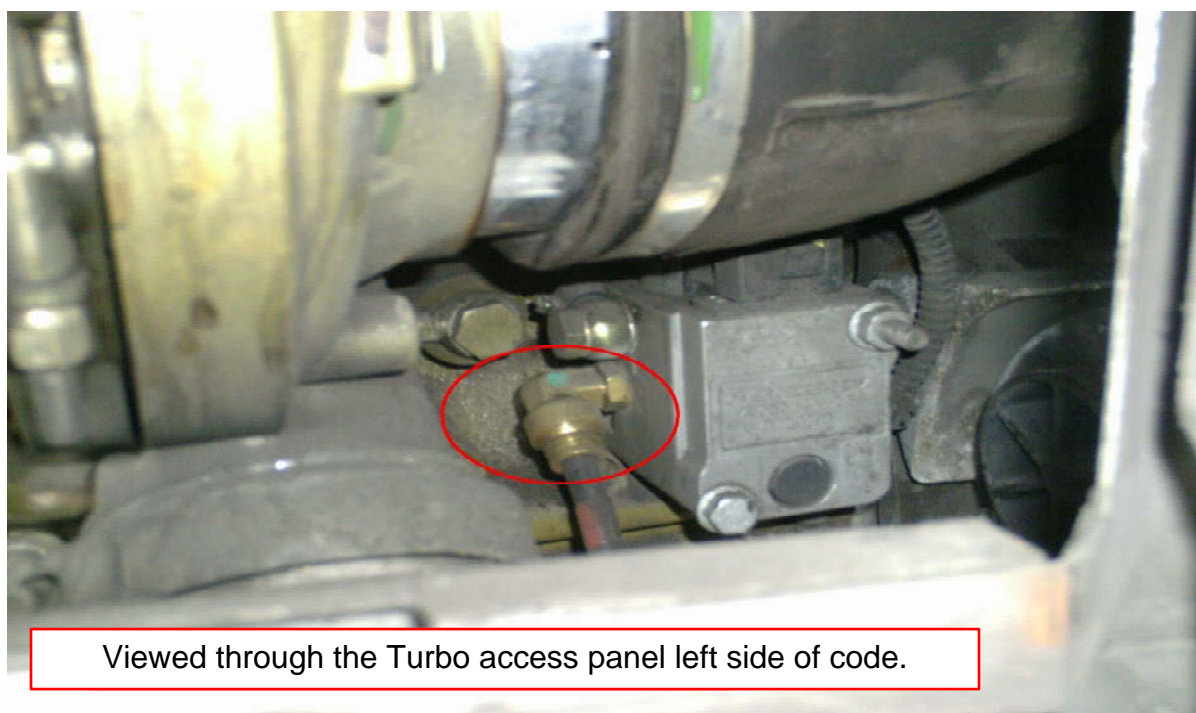

Viewed through the Turbo access panel left side of code.