

# **TECHNICAL BULLETIN**

TB1225

**ADDRESSEES**: ABC Customer Care and Parts Source

COACH/BUS MODEL : T900 Series

BULLETIN TYPE : Parts Information

**SECTION/CHAPTER**: Body and accessories

**DATE** : October 28, 2008

SUBJECT : Remanufactured body parts

**TERMS & CONDITIONS**: No claims will be accepted with reference to this Bulletin.

## **APPLICATION:**


The parts information subject of this Bulletin is applicable to following units:

 $28575 \rightarrow 28579$ ,  $28581 \rightarrow 28600$ ,  $29013 \rightarrow 29154$ ,  $29301 \rightarrow 29454$ ,  $29701 \rightarrow 29710$ ,  $29721 \rightarrow 29763$ ,  $29979 \rightarrow 29986$ ,  $42022 \rightarrow 42037$ ,  $42101 \rightarrow 42150$ 

## **DESCRIPTION:**

This Bulletin informs of T900 Series lamps and body parts that are no longer available as service replacements.

- 1. Front turn signal lamps VH 660740530 (RH) and VH 660740525 (LH), have been phased out by Hella, who manufacture these items.
- 2. Production of head lamp and turn signal lamp bezels VH 10558936 (RH) and VH 10558937 (LF), and grille VH 10558935 has also ceased (Figures 1 and 2).

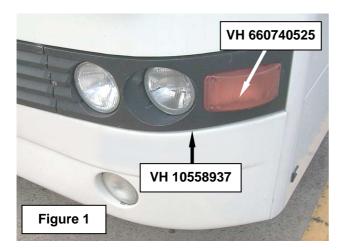

Description continued on next page.



3. To address the issue, Van Hool offer round Arcol turn signal lamp VH 10985539 as service replacement for the old oblong Hella lamps.

To accept the new turn signal lamps, new retro-look bezels have been designed and manufactured.


While not required, a remanufactured grille has been made available to update and complete the appearance of the installation.

Refer to the parts and products section below for more details.

<u>NOTE</u>: It is recommended that both left and right hand bezels be replaced at the same time to ensure that they can be readily serviced in the field.

## **PARTS AND PRODUCTS**:

## Old parts

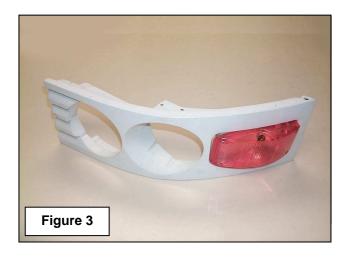


VH reference	Description	Qty.
VH 660740525	Lamp, turn signal, LH	1
VH 660740530	Lamp, turn signal, RH	1
VH 10558937	Bezel, headlamp and turn signal, LH, white	1
VH 10558936	Bezel, headlamp and turn signal, RH, white	1
VH 10558935	Grille, white	1

Continued on next page.

Page 2 of 4 TB1225\_USA\_en\_2008-10-28 VANHOOL

## **New parts**

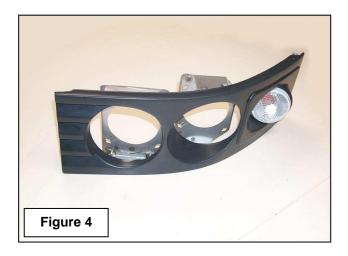

VH reference	Description	Qty.
VH 10985539	Lamp, turn signal, nondirectional, white lens	1
VH 10737576	Bulb, orange, to fit VH 10985539	1
VH 11070583	Bezel, headlamp and turn signal, LH, black, includes lamp frame	1
VH 11070582	Bezel, headlamp and turn signal, RH, black, includes lamp frame	1
VH 11070581	Grille assy, black, badge VH 660160605 not included	1

- Bezels and grille are of the angled louver design as found on later coaches. These parts also fit earlier coaches with flat louver design bezels and grille.
- Old and new parts are not interchangeable.
- Parts may be purchased from your nearest ABC Customer Care & Parts Source service center.
- Parts and products disposition: discard according to applicable environmental regulations.

## **SERVICE INFORMATION:**

Technical Bulletins are issued to supplement or supersede information in the Van Hool manuals. Note Technical Bulletin number, date and subject on the register at the end of the relevant chapter(s). File Technicak Bulletin separately for future reference.

VANHOOL TB1225\_USA\_en\_2008-10-28

THIS PAGE HAS BEEN LEFT BLANK INTENTIONALLY

Page 4 of 4 TB1225\_USA\_en\_2008-10-28

