



COACH MODEL: T2140, T2145,& C2045

DATE : 06/01/2016

SUBJECT : New Hazard Switch Wire Instruction

OLD PART PART # 660761405



NEW PART PART # 10753354



When changing switches a new plug is needed and wiring needs to be modified as shown below. Plug part number is 10753357.


Old plug wiring:

- 49a: Blue with Violet tracer
- 49: Blue with orange tracer
- 30b: Orange with Violet tracer
- R: Violet with Yellow tracer
- 30: Yellow
- 15: Yellow with Blue tracer
- L: Violet
- 31: Yellow with Blue tracer



49a: Blue with Violet tracer


- 49: Yellow
- 30b: Not used
- R: Violet with Yellow tracer
- 30: Orange with Violet tracer
- 15: Not used
- L: Violet
- 31: Use Spare Brown from unused dash switch light
- 58: Use Spare Grey from unused dash switch light

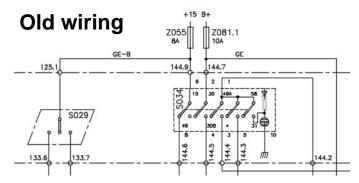

Other parts needed:

2ea. connector Part # 660765190 1ea. connector Part # 660766405

Reference to Service Bulletin No, 1105

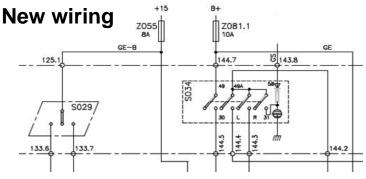

Note:

Take the "Yellow with Blue tracer wire" that was on pin 15 of old Switch, and the Blue with orange tracer wire" that was pin 49 old switch, and butt connect them together.