
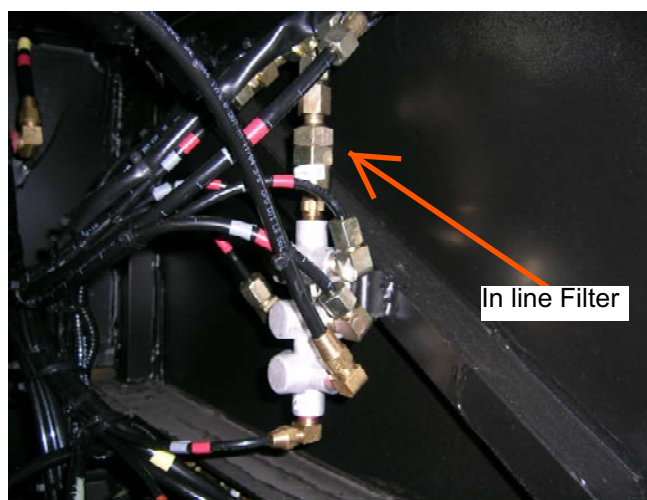


COACH MODEL : C2045, T2140, T2145
DATE : 01/03/2012
SUBJECT : Leveling valves slow to respond.

If coach leveling system is slow to respond in either the front, rear or both. Locate the inline filters as shown in pictures below.

The front in line filter is located on the drivers side door below the drivers window next to bumper release.

The rear inline filter is located on the front wall of the drive axle cavity above the drive axle service brake relay valve

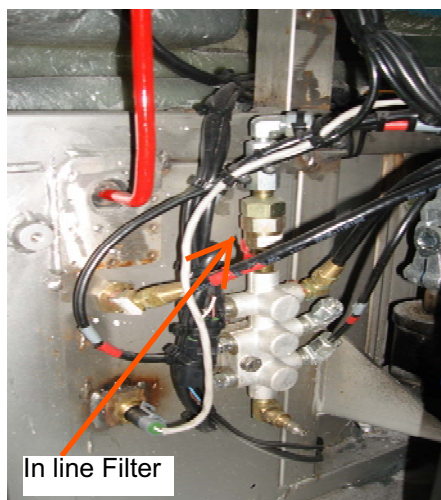

Release pressure from air system by actuating drain valve on accessories air tank. For the location of the air tanks refer to "Location of air tanks" in chapter 13.17.

Disconnect air line from filter body and remove filter.

Disassemble filter body in vise.

Clean or change filter screen.



Reassemble new or cleaned filter screen into filter body. Apply thin film of grease to new Oring.

Re-install filter in air line.

